

#####

## DELL(TM) UPDATE PACKAGES README FOR LINUX

#####

Version 6.3

Release Date: June 2010

This Readme contains updated information for your "Dell Update Packages for Linux Operating Systems User's Guide" and any other technical documentation included with the Dell Update Packages for Linux.

Dell Update Packages offer ease and flexibility for updating the system software on Dell PowerEdge(TM) systems. Update Packages are available for the following software components:

- \* System BIOS
- \* System firmware, also known as the Embedded Systems Management (ESM) firmware
- \* Dell Embedded Open Manage Server Administrator for ESXi Server version 4.0
- \* Dell Remote Access Controller (DRAC) firmware, which also includes Embedded Remote Access (ERA) firmware
- \* PowerEdge Expandable RAID Controller (PERC) firmware
- \* Software RAID Controller firmware
- \* Baseboard Management Controller (BMC) firmware
- \* SCSI Backplane (BP) firmware
- \* SAS BP firmware
- \* SAS Expander firmware
- \* SSD firmware
- \* SED firmware
- \* PowerVault 100T firmware
- \* PowerVault 110T firmware
- \* PowerVault MD1000 firmware
- \* PowerVault MD1120 firmware

- \* PowerVault MD1200 firmware
- \* PowerVault MD1220 firmware
- \* PowerVault RD1000 firmware
- \* Power Supply firmware
- \* Broadcom Network Adapter Firmware

#####  
**CONTENTS**  
 #####

- \* CRITICALITY
- \* MINIMUM REQUIREMENTS
- \* UPDATE PACKAGES: SUPPORTED COMPONENTS
- \* KNOWN ISSUES

#####  
**CRITICALITY**  
 #####

2 - Recommended

It is recommended that you apply this update during your next scheduled update cycle. The update contains feature enhancements or changes that will keep your system software current and compatible with other system modules (firmware, BIOS, drivers, and software).

#####  
**MINIMUM REQUIREMENTS**  
 #####

The Update Packages support Dell systems running the following Linux operating systems:

- \* Red Hat(R) Enterprise Linux(R) (RHEL) WS, ES, and AS (version 4.8) (both x86\_32 and x86\_64)
- \* Red Hat Enterprise Linux 5 server Update 5 (both x86\_32 and x86\_64)
- \* SUSE(R) Linux Enterprise Server 10 SP3 (x86\_64)
- \* SUSE Linux Enterprise Server 11 SP1 (x86\_64)
- \* VMware(R) ESX Server(TM) version 4.0 Update 1, VMware ESX Server version 4.1
- \* VMware ESXi Server(TM) version 4.0 Update 1, VMware ESX Server version 4.1 HDD

\* VMware ESXi Server version 4.0 Update 1,  
VMware ESX Server version 4.1 Update Flash

\* Citrix(R) Xen Server(TM) 5.6

NOTE: For the latest information about the various systems and operating systems that Dell Update Packages are supported on, see the "Dell Systems Software Support Matrix". This guide is available on the Dell Support website at "[www.support.dell.com/manuals](http://www.support.dell.com/manuals)".

Update Packages may also be applied in a pre-operating system environment that uses the Embedded Linux (ELI) environment through the Dell OpenManage(TM) Deployment Toolkit (DTK).

#####  
UPDATE PACKAGES: SUPPORTED COMPONENTS  
#####

Update Packages currently do not support all system component types. Dell will continue to make Update Packages available on additional devices in future.

This release of Update Packages supports updates to the devices listed in the following table.

Component Type	Supported Components
-----	
BIOS	
-----	
ESM firmware	ESM3, ESM4
-----	
Dell Embedded Open Manage Server Administrator	USB Flash with installed ESXi 4.0
-----	
DRAC firmware	ERA, ERA/O, DRAC 4, DRAC 5, iDRAC6
-----	
RAID firmware	PERC 4/Di, PERC 4e/Di, PERC 4e/DC, PERC 4e/Si, PERC 4/DC, PERC 4/SC, PERC H200, PERC H700, PERC H800 Adapter, PERC S300 Adapter, PERC 5/E, PERC 5/i, SAS 5/i, SAS 5/iR Adapter, SAS 5/E, SAS 5/iR, SAS 6/iR, SAS 6/iR Adapter, PERC 6/E, PERC 6/i, PERC 6/i Adapter, CERC6/i
-----	
BMC firmware	BMC
-----	
SCSI BP firmware	BP
-----	
SAS BP	BP
-----	

Storage enclosure PowerVault MD1000,  
PowerVault MD1120, PowerVault MD1200,  
PowerVault MD1220

-----  
Tape drives firmware PowerVault PV100T DDS4,  
PowerVault PV110T DAT72,  
PowerVault PV110T LTO1,  
PowerVault PV110T LTO2,  
PowerVault PV110T LTO2-L,  
PowerVault PV110T LTO3,  
PowerVault PV110T LTO3-HH,  
PowerVault PV110T LTO4,  
PowerVault PV110T SDLT320,  
PowerVault PV110T DLT VS80,  
PowerVault PV110T DLT VS160,  
PowerVault PV110T SDLT

-----  
Removable disk drive PowerVault RD1000  
backup firmware

#####  
KNOWN ISSUES  
#####

-----  
For all Dell Update Packages

-----  
\* Do not run other applications while executing Dell Update Packages.

\* For firmware Dell Update Packages, an update package will not inventory the device if only a native non-Dell driver is installed. Therefore, firmware update packages cannot upgrade a device with a native driver.

\* If the following error is displayed,  
"Error while loading shared libraries: libstdc++.so.5:  
cannot open shared object file: No such file or directory",  
install the compatibility libraries from your Linux distribution.

To install the compatibility libraries, use the following command:

```
"rpm -ivh compat-libstdc++-33-3.2.3-47.3.i386.rpm"
```

SLES 10 and SLES 11 (all service packs) uses  
"libstdc++-33-32bit-3.3.3-11.9.x86\_64.rpm"

\* If Update Packages stop abruptly due to a power outage or abnormal termination, perform the following steps:

1. Remove the lock file.
2. Type the following command to do so: "rm -f /var/lock/.spsetup"
3. Run the Update Package again.

\* If you see the message, "This Update Package is not compatible

with any of the devices detected on your system", for a supported device, ensure that you have the latest Dell drivers for your system from the Dell Support website at "www.support.dell.com."

- \* Some distributions of Linux may automatically mount a USB flash drive with the "-noexec" option. This prevents the execution of any file on that drive, including Dell Update Packages. If you are attempting to run a Dell Update Package from a USB flash drive under Linux, and are experiencing problems, remount the drive without the "-noexec" option, or copy the Dell Update Package to a drive mounted without the "-noexec" option.
- \* Dell Update Packages do not require new refreshes of existing DUPs to be reinstalled since the firmware or driver payload does not change when the DUP is refreshed. A new DUP is available if changes have been made to the firmware or driver payload.
- \* If the console terminal displays USB connection status messages, ignore them as they do not affect the system.
- \* On all versions of ESX the following the USB Connection message with errors, these messages can also be ignored. The following shows a typical message:  
Vendor: iDRAC    Model: MAS022        Rev: 1.00  
Type: Direct-Access            ANSI SCSI revision: 02  
  
VMWARE SCSI Id: Supported VPD pages for sdc : 0x1f  
VMWARE SCSI Id: Could not get disk id for sdc  
VMWARE: Unique Device attached as scsi disk sdc at scsi3, channel 0, id 0, lun 0  
Attached scsi removable disk sdc at scsi3, channel 0, id 0, lun 0  
SCSI device sdc: 327680 512-byte hdwr sectors (168 MB)  
sdc: Write Protect is on  
SCSI disk error : host 3 channel 0 id 0 lun 0 return code = 8000002  
Current sd08:21: sense key Data Protect  
Additional sense indicates Write protected  
I/O error: dev 08:21, sector 1  
SCSI disk error : host 3 channel 0 id 0 lun 0 return code = 8000002  
Current sd08:21: sense key Data Protect  
Additional sense indicates Write protected  
I/O error: dev 08:21, sector 1
- \* DUP require the linux executable lockfile, however, on XEN Server 5.6 lockfile is not installed by Default. You must install procmail yourself. You can download from [http://hb.us.dell.com/pub/Distros/xenserver/5.6/om\\_dev/rpms-prereqs/procmail-3.22-17.1.el5.centos.i386.rpm](http://hb.us.dell.com/pub/Distros/xenserver/5.6/om_dev/rpms-prereqs/procmail-3.22-17.1.el5.centos.i386.rpm) or simply copy [http://hb.us.dell.com/pub/Distros/xenserver/5.6/om\\_dev/rpms-prereqs/lockfile](http://hb.us.dell.com/pub/Distros/xenserver/5.6/om_dev/rpms-prereqs/lockfile) to /usr/bin.
- \* DUPs are designed to run only on a 32-bit environment. To run DUPs on a pure 64-bit environment, use the Dell YUM repository.
- \* If you attach VMedia on a system with the iDRAC Firmware version 1.5,

some DUPs may fail to work. To resolve this issue, run the following command:

```
racadm config -g cfgRacVirtual -o cfgLCDriveEnable 1
```

where `cfgLCDriveEnable` is an option implemented in iDRAC 1.5 with a default of 0 (disabled)

NOTE: This command enables LCDrive from the iDRAC console or the OS. If the LCDrive is not enabled, DUPs may not work.

After the DUP update is complete, to ensure the LCDrive is invisible, run the following command:

```
racadm config -g cfgRacVirtual -o cfgLCDriveEnable 0
```

\* When you run USC-related DUPs with Citrix(R) Xenserver(TM) 5.6.0-x, you need to set the virtual media in iDRAC to Detach. If you set the virtual media to Attach, the following error message is displayed:

```
"Inventory Failure: Secure Copy Failure - The Secure copy function has failed"
```

For BIOS updates, the following message is displayed:

```
"doDepCheck failed"
```

For other USC access related DUPs (PSU, NIC, SAS, PERC, BackPlane), the update is successful but the following error message may be displayed:

```
"... mount: block device /dev/secmasupd-SECUPD is write-protected ...  
/bin/cp: cannot create regular file ..."
```

-----  
Unified Server Configurator (USC) Dell Update Packages (DUPs)  
-----

\* Lifecycle controller updates require system services to be enabled.

\* For the first time, before you attempt to run Driver Package Diagnostics DUPs, execute the USC DUP.

\* Before running DUPs, ensure that there are no external devices mounted to `/media` or `/tmp`.

\* If the operating system is installed from "Operating System Deployment", select "Reboot and Exit" in the USC environment before booting to the operating system. This closes the USC session which is held for 18 hours. If you do not want to enter the USC and select "Reboot and Exit", but want to execute the DUPs within 18 hours, unplug the power supply of the system, wait for 10 seconds, and then power on the system.

- \* Due to the USB arbitration services of VMWare ESX 4.1, the USB devices appear invisible to the Hypervisor. So, when DUPs or the Inventory Collector runs on the Managed Node, the partitions exposed as USB devices are not shown, and it reaches the timeout after 15 to 20 minutes. This timeout occurs in the following cases:
- \* If you run DUPs or Inventory Collector on VMware ESX 4.1, the partitions exposed as USB devices are not visible due to the USB arbitration service of VMware ESX 4.1 and timeout occurs. The timeout occurs in the following instances:
  - When you start “DSM SA Shared Service” on the VMware ESX 4.1 managed node, it runs Inventory Collector. To work around this issue, uninstall Server Administrator or wait until the Inventory Collector completes execution before attempting to stop the “DSM SA Shared Service”.
  - When you manually try to run DUPs or the Inventory Collector on the VMware ESX 4.1 managed node while USB arbitration service is running. To fix the issue, stop the USB arbitration service and run the DUPs or the Inventory Collector.  
To stop the USB arbitration service:
    1. Use the “ps aux|grep” usb to check if the USB arbitration service is running.
    2. Use the “chkconfig usbarbitrator off” command to prevent the USB arbitration service from starting during boot.
    3. After you stop the usbarbitrator, reboot the server to allow the DUPs and/or the Inventory collector to run.

Note: If you require the usbarbitrator, enable it manually. To enable the usbarbitrator, run the command - chkconfig usbarbitrator on.

---

## BIOS

---

- \* A BIOS update requires enough free physical memory to load the entire BIOS image into physical memory. If there is insufficient free physical memory available on the system to load the BIOS image, the Dell Update Package for BIOS may fail. In this instance, you may attempt running the Dell Update Package immediately after reboot or after adding more memory. If this does not resolve the issue, update the BIOS using the diskette method.
- \* If the above memory limitation occurs on VMWare ESX Server, the problem is because the console operating system available memory is only 272 MB by default. Increase the console operating system memory to 800 MB temporarily and perform the firmware update. During ESX Server boot up, perform the following steps to increase the available memory:
  1. While booting, press "e" on the VMware ESX line (Grub option display screen).
  2. Press "e" again on the 'uppermem=' line and edit uppermem=819200.
  3. Press "Enter".

4. Press "e" on the kernel line (below the uppermem line).  
Edit the kernel line with mem=800M and press "Enter".
5. Press "b" to boot with these options.
6. Perform the firmware update.

\* BIOS update may issue the following kernel messages on the console and in "/var/log/messages":

```
dcd***: disagrees about the version of symbol struct_module
dcd***: Unknown symbol get_user_size
dcd***: Unknown symbol put_user_size
```

Ignore these messages because they do not refer to errors in BIOS update.

-----  
**ESM Firmware, BMC Firmware, BP Firmware, and DRAC 5 Firmware**  
 -----

\* Dell Update Packages for BMC, BP, ESM, and DRAC 5 require the OpenIPMI driver to be loaded on your system. The current drivers can be downloaded from the Dell Support website at "[www.support.dell.com](http://www.support.dell.com)."

Linux Operating System	OpenIPMI driver version	RPM files
Red Hat Enterprise Linux 4	33.13	"dkms-2.0.13-1.noarch.rpm" "openipmi-33.13.RHEL4-1dkms.noarch.rpm"
SUSE Linux Enterprise Server 9	36.8	"dkms-2.0.13-1.noarch.rpm" "openipmi-36.8.SLES9-1dkms.noarch.rpm"

NOTE: For SUSE Linux Enterprise Server version 10 and version 11, use the OpenIPMI driver provided with the operating system to run for Dell Update Packages.

-----  
**Dell Embedded Open Manage Server Administrator**  
 -----

The Dell Update Package for Dell Embedded OpenManage Server Administrator can only be applied in a pre-operating system environment that uses ELI through the Dell OpenManage(TM) Deployment Toolkit (DTK).

-----  
**DRAC 5 firmware**  
 -----



\* Before updating the DRAC firmware, ensure that the following conditions are met:

- USB is enabled
- IPMI is working properly
- DRAC Virtual Flash is not in use either by the operating system or by any other application

\* The Linux DUP in this release may not work on RHEL 5. It works on earlier versions of RHEL. In cases where it does not work, use the web pack to perform this update.

---

#### Power Supply Unit firmware

---

\* Power Supply Unit firmware updates can be performed only on Life Cycle Controller enabled systems.

---

#### All PERC firmware and all SAS firmware

---

\* Do not run storage controller update packages if the controller is in use by other applications.

The firmware upgrade may fail if any of the RAID controllers in the system are performing an I/O background task (consistency check, background initialization, rebuild, or reconstruction). Allow the background task to complete before attempting to upgrade the firmware. "Patrol Read" tasks will not affect a firmware upgrade.

\* Linux systems running one or more applications that interact with SCSI devices in certain ways are known to cause a kernel panic situation. Therefore, it is recommended that you stop Dell OpenManage Server Administrator and Dell OpenManage Server Administrator Storage Management Service before running storage controller firmware update packages.

To stop the Dell OpenManage Server Administrator service, run "omconfig system webserver action=stop"

To start the Server Administrator service, run "omconfig system webserver action=start"

To stop the Server Administrator Storage Management Service, run "/etc/init.d/dataeng stop"

To start the Server Administrator Storage Management Service, run "/etc/init.d/dataeng start"

---

#### PERC 4 firmware

- 
- \* Firmware updates require a reboot to take effect.
  - \* PERC 4 update packages may fail if the system has an older version of the Megaraid controller driver installed. To correct the problem, update the Megaraid controller driver to version 2.20.4.5 or later.
  - \* The firmware update fails on ESX server. Use DTK to perform the upgrade.

---

#### PowerVault MD1000 firmware

---

- \* The PowerVault update procedure requires the RAID controller to be in a known good state. If a problem occurs with the RAID controller during the update procedure, and the Update Packages cannot communicate with the PowerVault system, inventory its firmware version, or perform the update. (138462)

---

#### PowerVault MD1000 firmware

---

- \* Stop all input/output to the PowerVault MD1000 before running the PowerVault MD1000 firmware update package.
- \* **WARNING: THE SERVER MUST BE REBOOTED AFTER UPDATING THE FIRMWARE ON MD1000 ENCLOSURES IN ORDER TO MAINTAIN ENCLOSURE MANAGEMENT. ACCESS TO THE ENCLOSURES WILL BE LOST IF THE SERVER IS NOT REBOOTED.**
- \* When prompted for reboot after the update, select "Yes".

---

#### PowerVault PV100T DDS4 firmware and all PowerVault PV110T firmware (PV110T DDS4, PV110T DAT72, PV110T LTO1, PV110T LTO2, PV110T LTO2-L, PV110T LTO3-HH, PV110T LTO4, PV110T SDLT320, PV110T LTO3, PV110T DLT VS80, PV110T DLT VS160, and PV110T SDLT)

---

- \* Before executing the firmware update, stop all tape backup activity and place all scheduled jobs on hold.
- \* After the firmware update is completed, restart your system for the updates to take effect.
- \* Note: Tape automation devices are not supported by Dell Update Packages. Disconnect or power off such devices before executing Dell Update Packages.

The tape automation devices are as follows:

1. PowerVault PV120T

2. PowerVault PV122T
3. PowerVault PV124T
4. PowerVault PV128T
5. PowerVault PV130T
6. PowerVault PV132T
7. PowerVault PV136T
8. PowerVault PV160T
9. PowerVault ML6000

-----  
NIC firmware  
-----

Broadcom NIC firmware updates are not supported on 8th generation systems but are supported on newer systems provided the hardware is present.

-----  
Dell Embedded Open Manage Server Administrator (Open Manage VIB)  
-----

DUP will support updating the OMSA for ESXi 4.0 U1.

Note: You cannot perform the DUP Update of OMSA for ESXi 4.1 due to VMware code changes in the update mechanism.

#####

Information in this document is subject to change without notice.  
(C) 2010 Dell Inc. All rights reserved.

Reproduction of these materials in any manner whatsoever without the written permission of Dell Inc. is strictly forbidden.

Trademarks used in this text: "Dell", "PowerVault", "PowerEdge" and "OpenManage" are trademarks of Dell Inc.; "Intel" is a registered trademark of Intel Corporation; "Red Hat" and "Red Hat Enterprise Linux" are registered trademarks of Red Hat, Inc.; "SUSE" is a registered trademark of Novell, Inc. in the United States and other countries; "VMware" is a registered trademark and "ESX Server" is a trademark of VMware, Inc.; "Citrix" and "XenServer" are either trademarks or registered trademarks of Citrix Systems, Inc. in the United States and/or other countries.

Other trademarks and trade names may be used in this document to refer to either the entities claiming the marks and names or their products. Dell Inc. disclaims any proprietary interest in trademarks and trade names other than its own.

The software contained in a Dell Update Package for Linux is an aggregate of third party programs as well as Dell programs. Use of the software is subject to designated license terms. All Software that is designated as "under the terms of the GNU GPL" may be copied, distributed and/or modified in accordance with the terms and conditions of the GNU General Public License, Version 2, June 1991. All software that is designated as "under the terms of the GNU LGPL"

(or "Lesser GPL") may be copied, distributed and/or modified in accordance with the terms and conditions of the GNU Lesser General Public License, Version 2.1, February 1999. Under these GNU licenses, you are also entitled to obtain the corresponding source files by contacting Dell at 1-800-WWW-DELL. Please refer to the Open Manage Open Source DVD. There may be a nominal fee charged to you for the physical act of transferring a copy.

June 2010