# Cable Routing Procedures for Dell<sup>TM</sup> PowerEdge<sup>TM</sup> T710 Systems

A Dell™ Technical White Paper

Dell™ | Datacenter Infrastructure Engineering

By Chris Kitten and Jose L. Flores

March 2011





# Contents

Introdu	CTION	٠.
Section	1: Cabling a Dell™ PowerEdge™ T710 With a Cable Management Arm (CMA)	.2
1.1	Connecting the CMA Cables to the System	.2
1.2	Routing the Power Cables Through the Strain Reliefs	.3
1.3	Installation of the CMA	
Section	2: Cabling a Dell™ PowerEdge™ T710 System Without a CMA	
2.1	Routing the Cables	
Section	Section 3: Replacing a Power Supply on a PowerEdge™ T710 System With a CMA	
Table	of Figures	
Table	of Figures	
Figure 1:	System with Cables Installed	2
Figure 2:	Routing Power Cables Through the Strain Reliefs	3
Figure 3:	Routing the Cables Through the CMA	4
Figure 4:	Right-Side Mounted CMA Installation	4
Figure 5:	Left-Side Mounted CMA Installation	5
Figure 6:	Cable Routing Without a CMA	5
Figure 7:	Replacing the Power Supply	6

#### Introduction

This white paper covers recommended cable routing procedures for Dell™ PowerEdge™ T710 systems in the following racks:

- PowerEdge™ 2410
- PowerEdge™ 4210
- PowerEdge™ 2420
- PowerEdge<sup>™</sup> 4220 (including wide and deep versions)
- PowerEdge<sup>™</sup> 4820 (including wide and deep versions)

If you are using the optional CMA, following these procedures will allow you to extend the system from the rack for service without powering down or disconnecting the cables. If you are not using the CMA, following these procedures will ensure secure attachment and strain relief of the cables behind the system. For guidelines on how to route cables within the rack, refer to the Dell *Best Practices Guide for Rack Enclosures* white paper.

# Section 1: Cabling a Dell™ PowerEdge™ T710 With a Cable Management Arm (CMA)

This section details how to cable a PowerEdge<sup>TM</sup> T710 system using a CMA. If you are cabling the system without the optional CMA, refer to Section 2.

Follow the instructions contained in the *Rack Installation Guide* in the rail kit to install the server into the rack. Once installed, use these instructions to install the cables. All illustrations in the following sections were created using a PowerEdge<sup>TM</sup> T710 system.

**NOTE:** PowerEdge<sup>™</sup> T710 systems are compatible with the PowerEdge<sup>™</sup> T610 rails and CMAs.

#### 1.1 Connecting the CMA Cables to the System

Attach the CMA tray to the back of the rails as described in the CMA Installation Instructions provided in the CMA kit. Connect all applicable cables to the rear of the system and verify that all connections are secure. See Figure 1.





#### 1.2 Routing the Power Cables Through the Strain Reliefs

After you have installed the tray and cables, route the power cables through the strain reliefs located on the power supply handles as shown in Figure 2.

Figure 2: Routing Power Cables Through the Strain Reliefs



#### 1.3 Installation of the CMA

**NOTE**: For guidelines on how to route cables within the rack, refer to the Dell *Best Practices Guide for Rack Enclosures* white paper.

**NOTE:** If you are installing fiber-optic cables in the CMA, a cable bend radius of at least 1 inch must be maintained throughout the length of the cable. It is recommended that fiber-optic cables be routed on the exterior of the cable bundle to increase the bend radius of the fiber-optic cables through the CMA. Additionally, a large amount of slack at the entrance and exit of the CMA is recommended.

- 1. Install the CMA on either the rear right or rear left side of the rails by attaching both CMA housings to the attachment brackets on the rails.
- 2. Route the cables through the CMA while avoiding twisting the cables. Use the hook and loop straps on the CMA to secure the cables. See Figure 3.
- 3. If the cable bundle includes a keyboard, video, and mouse (KVM) dongle, place the dongle inside the CMA basket
- 4. Once you have routed all the cables through the CMA, dress the cable slack between the back of the system and the entrance of the CMA using the tie wraps (shown in yellow in all illustrations) provided in the CMA kit.
- 5. Clip off the excess length of material from the tie wraps. Make sure that the heads of the tie wraps are positioned so as to avoid interference with adjacent systems. Return the CMA to the closed (retracted) position.
- 6. Extend the system out of the rack to verify that there is sufficient slack in the cables on both ends of the CMA.

See Figure 4 for an example of a completed right-side mounted CMA installation. See Figure 5 for an example of a completed left-side mounted CMA installation.

Figure 3: Routing the Cables Through the CMA



NOTE: Do not store excess cable slack inside the CMA. The cable may protrude through the CMA, thus causing binding and potentially damaging the cable.

Cables entering the CMA should have a small amount of slack to avoid cable strain when the CMA is extended.

KVM dongle placed inside the basket.





Figure 5: Left-Side Mounted CMA Installation



## Section 2: Cabling a Dell™ PowerEdge™ T710 System Without a CMA

**NOTE**: The CMA on Dell<sup>TM</sup> PowerEdge<sup>TM</sup> T710 systems is optional. Without the CMA installed, the system must be powered down and all cables disconnected before it can be removed from the rack.

#### 2.1 Routing the Cables

- 1. Connect all applicable cables to the rear of the system and verify that all connections are secure.
- 2. Using the hook and loop straps supplied with the rail kit, bundle the cables and secure them to either the left or right CMA attachment brackets as described in the *Rack Installation Instructions*. See Figure 6 for an example of data cables secured to the right CMA bracket and power cables secured to the left CMA bracket.
- 3. It is recommended that the cables be secured to the outer brackets, but cables may be secured to the inner brackets as well if desired.

Figure 6: Cable Routing Without a CMA



# Section 3: Replacing a Power Supply on a PowerEdge™ T710 System With a CMA

- 1. Remove the CMA tray.
- 2. Swing the CMA to its service position.
- 3. Disengage the strain relief and disconnect the power cord from the power supply.
- 4. Remove and replace the power supply as shown in Figure 7.
- 5. Plug in the power cord, re-engage the strain relief, return the CMA to the closed (retracted) position, and reinstall the CMA tray.

Figure 7: Replacing the Power Supply

